

Date received: 19-04-12
Date of issue: 07-05-12
Report consists of 2 test reports.
Defects before testing: None
Sample name: MALMO

PEDRALI S.P.A.
STRADA PROVINCIALE 122
24050 MORNICO AL SERIO (BG)
ITALIA

TEST REPORT N° 140545

Overall dimensions: 585 x 515 x 780 (h) mm

List performed tests:

1. Seat and back static load test EN 1728:2000
2. Seat and back fatigue test EN 1728:2000



This document is validated by digital signature and time stamping in accordance with the Italian laws and the European Directives which regulate the electronic signature systems.

Managing Director
Dr. Andrea Giavon


The sample name and, when relevant, its description, are given by the orderer, and CATAS does not assume responsibility on this matter. This test report relates to the sample submitted for the test and no others. Additions, deletions or alterations are not permitted. This test report must always be reproduced in its entirety. Unless otherwise stated, sampling has been carried out by the orderer.

TEST REPORT N° 140545

Date of issue: 07-05-12
Sample weight: Not determined
Sample name: MALMO



Side view



Rear view



Bottom view

The sample name and, when relevant, its description, are given by the orderer, and CATAS does not assume responsibility on this matter. This test report relates to the sample submitted for the test and no others. Additions, deletions or alterations are not permitted. This test report must always be reproduced in its entirety. Unless otherwise stated, sampling has been carried out by the orderer.

TEST REPORT

140545 / 1

Date received: 19-04-12
Date of test: 26-04-12
Date of issue: 07-05-12



Sample name: MALMO

PEDRALI S.P.A.
STRADA PROVINCIALE 122
24050 MORNICO AL SERIO (BG)
ITALIA

Seat and back static load test EN 1728:2000

Seat and back static load test, clause 6.2.1

Test results:

Seat load N	Back force N	Number of cycles	Remarks
2.000	700	10	No defects

Seat front edge static load, clause 6.2.2

Seat load N	Number of cycles	Remarks
2.000	10	No defects

Note:

The test has been carried out according to table 1 of EN 15373:2007, level 3 - severe.

This document is validated by digital signature and time stamping in accordance with the Italian laws and the European Directives which regulate the electronic signature systems.

*Managing Director
Dr. Andrea Giavon*

The sample name and, when relevant, its description, are given by the orderer, and CATAS does not assume responsibility on this matter. This test report relates to the sample submitted for the test and no others. Additions, deletions or alterations are not permitted. This test report must always be reproduced in its entirety. Unless otherwise stated, sampling has been carried out by the orderer.

TEST REPORT

140545 / 2

Date received: 19-04-12

Date of test: 26-04-12

Date of issue: 07-05-12



Sample name: MALMO

PEDRALI S.P.A.
STRADA PROVINCIALE 122
24050 MORNICO AL SERIO (BG)
ITALIA

Seat and back fatigue test EN 1728:2000

Seat and back fatigue test, clause 6.7

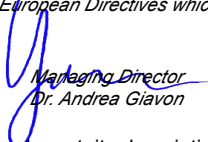
Test results:

Seat force N	Back force N	Number of cycles	Remarks
1.000	300	200.000	No defects

Note:

The test has been carried out according to table 1 of EN 15373:2007, level 3 - severe.

This document is validated by digital signature and time stamping in accordance with the Italian laws and the European Directives which regulate the electronic signature systems.


Managing Director
Dr. Andrea Giavon